

Date: Friday, 17/10/2008 7:55:59 AM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b> : CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> : 206L FWD X-TUBE
<b>Job Number</b> : 42706	
<b>Estimate Number</b> : 13220	
<b>P.O. Number</b> :	<b>Part Number</b> : D206667103TRN
<b>This Issue</b> : 17/10/2008 <b>S.O. No.</b> :	<b>Drawing Number</b> : D206-667-143 REV B
<b>Prsht Rev.</b> : NC	<b>Project Number</b> : N/A
<b>First Issue</b> : / / <b>Type</b> : CROSSTUBES	<b>Drawing Revision</b> : B
<b>Previous Run</b> : 42302	<b>Material</b> :
<b>Written By</b> :	<b>Due Date</b> : 24/10/2008 <b>Qty:</b> 1 <b>Um:</b> Each
<b>Checked &amp; Approved By</b> : <u>JUD 08.10.07</u>	
<b>Comment</b> : Est Rev:A 08-03-06 new issue DD verified by:ec Est Rev B 08.04.02 removed polish EC verified by DD	

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	D6002115	Crosstube Material
-----	----------	--------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6002-115 Crosstube B 34684

Check OD = 2.250"; ID = 1.750"

A.m 08.10.27 ②

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-File down transition lines smooth.

A.m 08.10.27 ①

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------

**Comment:** INSPECT ALL DIM TO DIM SHEETA.m 08.10.27 ①

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-File down transition lines smooth.

3-Remove sand and plugs

A.m 08.10.27 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 17/10/2008 7:55:59 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 42706

Part Number: D206667103TRN

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

A.M. 08.10.27

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

AWM 8-10-27

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM 8-10-27

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D 11-10-27

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock in kanban rack

Location:

X-TUBE CELL

AWM 8-10-27

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/10/27

Job Completion



MF 08-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 42700
<b>Description:</b> Crosstube Assembly (206L High Fwd)		<b>Part Number:</b> D206-667-143
<b>Inspection Dwg:</b> D206-667-143 <b>Rev:</b> B		<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	/			
	1.982	+0.005/-0.000	1.987	/			
	2.019	+0.005/-0.000	2.024	/			
	2.058	+0.005/-0.000	2.063	/			
	2.097	+0.005/-0.000	2.102	/			
	2.136	+0.005/-0.000	2.141	/			
	2.176	+0.005/-0.000	2.181	/			
	2.201	+0.005/-0.000	2.205	/			
	0.125	+/-0.010	0.125	/			
	0.400 x 30°	+/-0.010	0.400x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			
SIDE B	104.98	+/-0.020	104.980	/			
	2.240	+0.005/-0.000	2.245	/			
	1.982	+0.005/-0.000	1.987	/			
	2.019	+0.005/-0.000	2.024	/			
	2.058	+0.005/-0.000	2.063	/			
	2.097	+0.005/-0.000	2.102	/			
	2.136	+0.005/-0.000	2.141	/			
	2.176	+0.005/-0.000	2.181	/			
	2.201	+0.005/-0.000	2.205	/			
	0.125	+/-0.010	0.125	/			
	0.400 x 30°	+/-0.010	0.400x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			

<b>Measured by:</b> Am	<b>Audited by:</b> AWM	<b>Prototype Approval:</b> N/A
<b>Date:</b> 09.10.27	<b>Date:</b> 8-10-27	<b>Date:</b> N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	



DESIGN PH	DRAWN BY PH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD) SCALE NTS	
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED  
05-07-26 H

**UNDER REVIEW**

05-07-10 PH

re-draw detail F

PH  
08.10.17

Qty	Part Number	Description
X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
1	D6002-115	CROSSTUBE
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-20	CLAMP






#### GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6002-115  
FINISHED LENGTH =  $104.98 \pm 0.020$
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE COPY OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS RETURN TO SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT ENGINEERING UNCONTROLLED COPY LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. UNCONTROLLED COPY
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-TO AMENDMENT 241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

NO. 42706

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

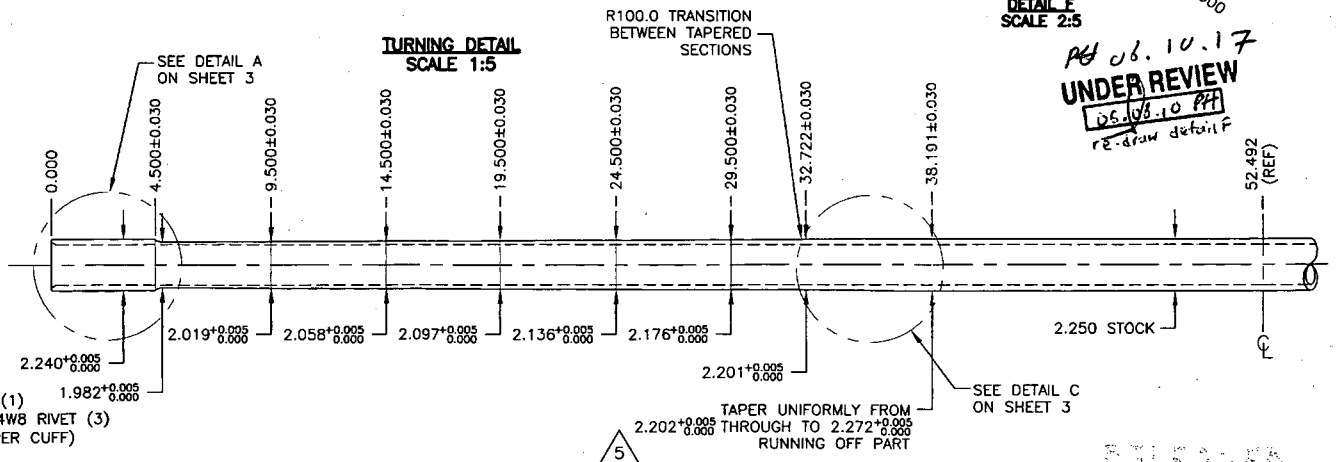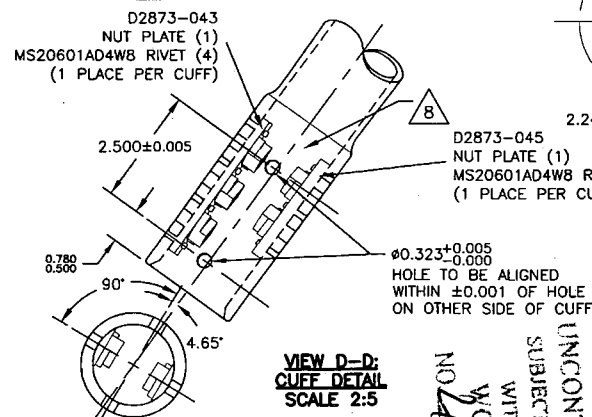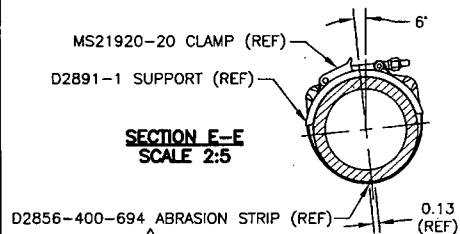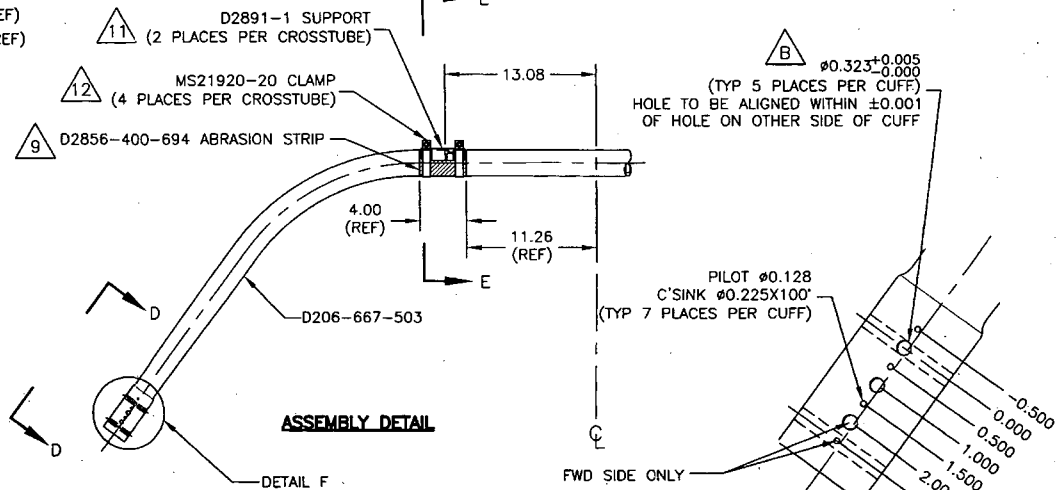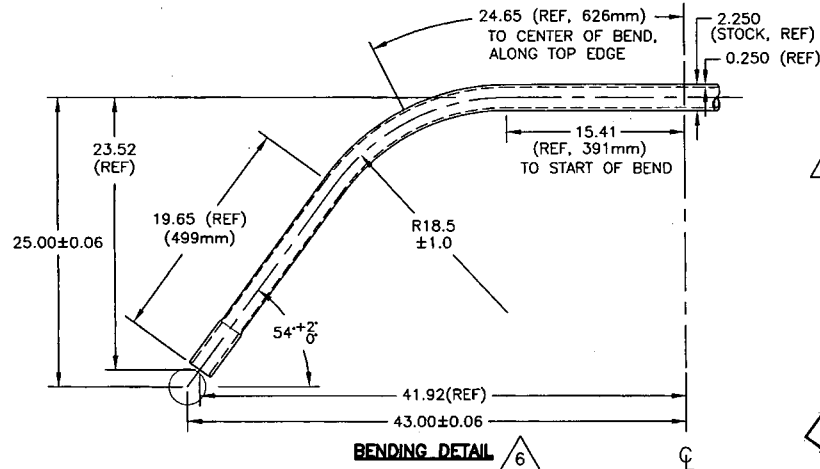

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA	REV. B
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		PH	PH		
		CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	SHEET 2 OF 3
		DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE 1:10


NO. 206-667-143

SHIP COPY  
RE URN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER

PH 05.10.17  
UNDER REVIEW  
05.08.10 PH  
re-draw detail F

05.07.26

# DETAIL A: CROSSTUBE CUFF

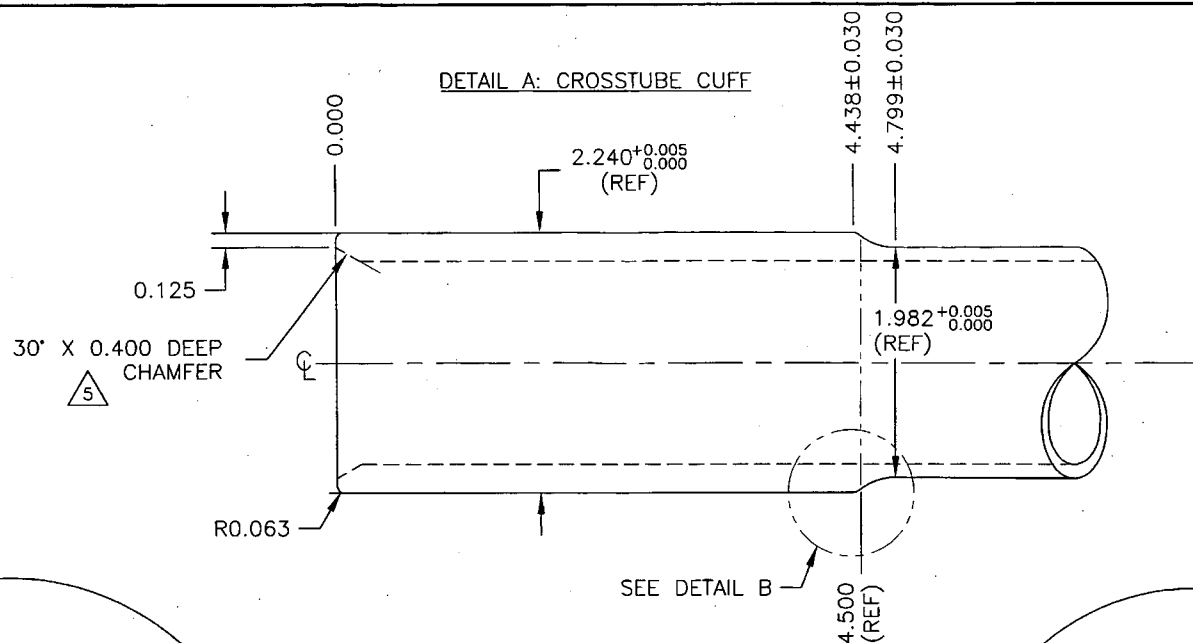

05.07.26


08.10.12

**UNDER REVIEW**


06.08.10 PH

re draw detail F

## DETAIL B: CUFF TRANSITION SCALE 4:1

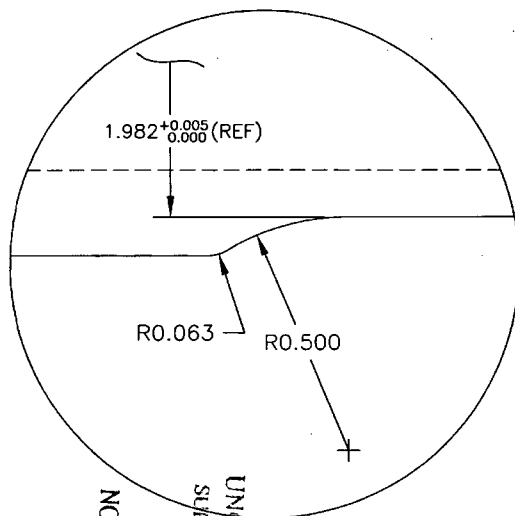

## DETAIL C: TAPER RUN-OFF NOT TO SCALE

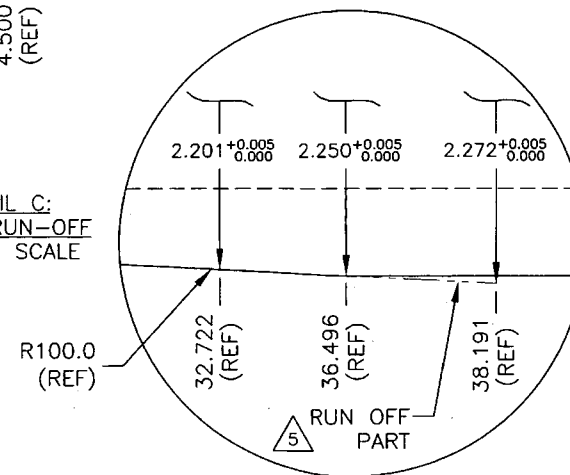

NO. 42004

WORK ORDER

WITHOUT NOTICE

SUBJECT TO AMENDMENT

UNCONTROLLED COPY

ENGINEERING

RETURN TO

SHOP COPY

COPYRIGHT © 2000 BY DART AEROSPACE LTD.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	DESIGN	DRAWN BY	<b>DART</b>	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA	
	PH	PH			
	CHECKED	APPROVED	DRAWING NO.		REV. E
	<i>[Signature]</i>	<i>[Signature]</i>	D206-667-143		SHEET 3 OF 3
	DATE	TITLE	SCALE		
05.07.26	CROSSTUBE ASS'Y (206L HIGH FWD)	1:1			